



Organisme pour la sécurité  
De l'aviation civile

**U R G E N T**

**Département Gestionnaire de la Sécurité**

---

Emetteur (From): Contact.Documentation@osac.aero  
N°: 05/24/RDO/OSAC/DMSR

Page : Nb de pages: 1 + 3  
Date : 05 février 2024

**Destinataire(s) (To): Pour les personnes concernées (To whom it may concern)**

**OBJET : Avis d'émission de l'AD urgente de l'EASA de référence EAD 2024-0037-E**  
*(EASA EAD 2024-0037-E issuing notice)*

**AUSTRO ENGINE GmbH  
Moteur E4 et E4P  
Engine – Main Bearing / Studs – Replacement**

**Le présent avis signale l'émission de la Directive de Navigabilité EASA citée en objet dont le texte est joint.**

*This notice reports the issuing of the subject EASA AD which is enclosed.*

**Cette AD est, réglementairement, directement applicable sur les aéronefs inscrits au registre français.**

*According to the rules, this AD is directly applicable to the French registered affected aircraft.*



## Emergency Airworthiness Directive

**AD No.:** 2024-0037-E

**Issued:** 02 February 2024

Note: This Emergency Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

### Design Approval Holder's Name:

AUSTRO ENGINE GmbH

### Type/Model designation(s):

E4 and E4P engines

**Effective Date:** 06 February 2024

**TCDS Number(s):** EASA.E.200

**Foreign AD:** Not applicable

**Supersedure:** None

## ATA 72 – Engine – Main Bearing / Studs – Replacement

### Manufacturer(s):

Austro Engine GmbH; Wuhu Diamond Aeroengine Co. Ltd

### Applicability:

E4 and E4P engines, all serial numbers (s/n).

These engines are known to be installed on, but not limited to, Diamond Aircraft Industries DA 40 NG, DA 42 NG, DA 42 M-NG and DA 62 aeroplanes.

### Definitions:

For the purpose of this AD, the following definitions apply:

**The MSB:** Austro Engine Mandatory Service Bulletin (MSB) MSB-E4-042.

**Affected part:** Main bearing screws, class 8.8, having Part Number (P/N) E4A-10-100-201.

**Serviceable part:** Main bearing screws, class 12.9, having P/N E4A-10-100-202.

**Groups:** Group 1 are engines having a s/n listed in Table 1 of the MSB, or engines equipped with an engine core having a s/n listed in Table 1 of the MSB.



Group 2 are engines having a s/n listed in Table 2 of the MSB or engines equipped with an engine core having a s/n listed in Table 2 of the MSB.

Group 3 are engines which are not Group 1 and are not Group 2.

**Reason:**

Occurrences of engines failures have been reported, where, during subsequent engine inspection, failure of one inner main bearing screw was identified. Subsequent investigation determined that certain screws, meeting the lower end of their design specification, could fail when installed on the inner main bearing position and the engine is operated in specific operating conditions.

This condition, if not corrected, could lead to engine failure, reduced control of the aeroplane and, for single engine aeroplanes, in emergency landing, possibly resulting in damage to the aeroplane and injury to occupants.

To address this potential unsafe condition, Austro Engine published the MSB, providing instructions to replace the affected part with screws of higher class.

For the reason described above, this AD requires replacement of affected parts with serviceable parts and provides additional criteria for installation of parts and engines.

**Required Action(s) and Compliance Time(s):**

Required as indicated by this AD, unless the actions required by this AD have been already accomplished:

**Replacement:**

- (1) For Group 1 and Group 2 engines: Within the compliance time as specified in Table 1 of this AD, as applicable, replace each affected part installed on the inner main bearings with a serviceable part in accordance with the instructions of the MSB.

Table 1 – Main Bearing Screws Replacement

Group	Compliance Time
1	Before next flight after the effective date of this AD. A single ferry flight, without passengers and not exceeding 3 flight hours (FH), is allowed to a maintenance location, where the action required by this AD can be accomplished
2	A or B, whichever occurs first: A) Within 300 FH since first installation on an aeroplane, or since last overhaul, as applicable B) During the next scheduled engine maintenance, starting after the effective date of this AD

**Part(s) Installation:**

- (2) For Group 1, Group 2 and Group 3 engines: From the effective date of this AD, do not install an engine core, having a s/n listed in Table 1 or Table 2 of the MSB, on any engine, unless the main



bearing screws installed on the inner main bearings of that engine core have been replaced with serviceable parts in accordance with the instructions of the MSB.

- (3) For Group 1, Group 2 and Group 3 engines: From the effective date of this AD, do not install any affected part on the inner main bearings of any engine (position 3 to 8 inclusive, as shown in Figure 1 of the MSB).

#### Ref. Publications:

Austro Engine MSB MSB-E4-042 original issue, dated 31 January 2024.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

#### Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The results of the safety assessment have indicated the need for immediate publication and notification, without the full consultation process.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact Austro Engine GmbH, Rudolf-Diesel-Str. 11, 2700 Wiener Neustadt, Austria, via [Diamond Partners Portal](#), or by Telephone: +43 2622 23000 2525.



## TRADUCTION DE COURTOISIE

de la DIRECTIVE de NAVIGABILITE de l'EASA de référence 2024-0037-E

### AUSTRO ENGINE GmbH Moteur E4 et E4P

#### DATE D'ENTREE EN VIGUEUR :

06 février 2024.

#### CONSTRUCTEUR(S) :

Austro Engine GmbH ; Wuhu Diamond Aeroengine Co. Ltd

#### APPLICABILITE :

Moteurs E4 et E4P, tous numéros de série (s/n).

Ces moteurs sont connus pour être installés, mais sans s'y limiter, sur les avions Diamond Aircraft Industries DA 40 NG, DA 42 NG, DA 42 M-NG et DA 62.

#### DEFINITIONS :

Dans le cadre de la présente CN, les définitions suivantes s'appliquent :

**Le MSB** : Austro Engine Mandatory Service Bulletin (MSB) MSB-E4-042.

**Pièce affectée** : Vis de palier principal, classe 8.8, ayant pour numéro de pièce (P/N) E4A-10-100-201.

**Pièce en bon état** : Vis de palier principal, classe 12.9, ayant pour numéro de pièce (P/N) E4A-10-100-202.

#### **Groupes :**

Le groupe 1 comprend les moteurs dont le numéro de série figure dans le tableau 1 du MSB ou les moteurs équipés d'un moyeu de moteur dont le numéro de série figure dans le tableau 1 du MSB.

Le groupe 2 comprend les moteurs dont le numéro de série figure dans le tableau 2 du MSB ou les moteurs équipés d'un moyeu de moteur dont le numéro de série figure dans le tableau 2 du MSB.

Le groupe 3 est constitué des moteurs qui ne sont ni du groupe 1 ni du groupe 2.

#### RAISON :

Des pannes de moteur ont été signalées, où, lors d'une inspection ultérieure du moteur, la défaillance d'une vis du palier principal intérieur a été identifiée. Une enquête ultérieure a permis de déterminer que certaines vis, correspondant à la limite inférieure de leur spécification de conception, pouvaient se rompre lorsqu'elles étaient installées sur le palier principal intérieur et que le moteur était utilisé dans des conditions d'exploitation spécifiques.

Cette situation, si elle n'est pas corrigée, peut entraîner une panne moteur, une perte de contrôle de l'avion et, pour les avions monomoteurs, un atterrissage d'urgence, ce qui peut endommager l'avion et blesser les occupants.

Pour remédier à cette situation potentiellement dangereuse, Austro Engine a publié le MSB, qui fournit des instructions pour remplacer la pièce concernée par des vis de classe supérieure.

Pour la raison décrite ci-dessus, la présente CN exige le remplacement des pièces concernées par des pièces en état de marche et fournit des critères supplémentaires pour l'installation des pièces et des moteurs.

#### **ACTIONS ET DELAIS D'APPLICATION :**

Sauf si déjà accomplies, les actions suivantes sont rendues impératives :

##### **Remplacement :**

(1) Pour les moteurs des groupes 1 et 2 : Dans le délai de conformité spécifié dans le tableau 1 de la présente CN, selon le cas, remplacer chaque pièce affectée installée sur les paliers principaux intérieurs par une pièce en bon état conformément aux instructions du MSB.

Tableau 1 - Remplacement des vis du palier principal

<b>Groupes</b>	<b>Délai de mise en conformité</b>
1	Avant le prochain vol après la date d'entrée en vigueur de la présente CN. Un seul vol de convoyage, sans passagers et ne dépassant pas 3 heures de vol (FH), est autorisé vers un site d'entretien où l'action requise par cette CN peut être accomplie.
2	A ou B, selon ce qui se produit en premier :  A) dans les 300 FH suivant la première installation sur un avion ou la dernière révision, selon le cas  B) Au cours de la prochaine maintenance programmée du moteur, à compter de la date d'entrée en vigueur de la présente consigne de navigabilité.

##### **Installation de pièce(s) :**

(2) Pour les moteurs des groupes 1, 2 et 3 : À partir de la date d'entrée en vigueur de la présente CN, ne pas installer sur un moteur un moyeu de moteur dont le numéro de série figure dans le tableau 1 ou le tableau 2 du MSB, à moins que les vis du palier principal installées sur les paliers principaux intérieurs de ce moueu de moteur n'aient été remplacées par des pièces en bon état de fonctionnement conformément aux instructions du MSB.

##### **DOCUMENTS DE REFERENCE :**

Austro Engine MSB MSB-E4-042 édition originale daté du 31 Janvier 2024.

L'utilisation de révisions ultérieures approuvées de ces documents est un moyen acceptable de conformité aux exigences de cette CN.

##### **REMARQUES :**

[...]